#### Overview

- The UM (Ultra-Miniature) series consists of ultrasmall-size coaxial connectors that are most suitable for very thin coaxial cables having a high reliability.
- Two types of lock are available: the screw-lock type and the quick-lock type. The quick-lock type has been approved in Defense Agency standards NDS XC6115 and DSP C6205.
- Two connecting methods are available: the solderless connecting system, in which the simplicity and accuracy of the work of connecting the wiring is greatly increased; and the screw-clamp system, in which wires can be connected accurately.

#### Main materials used

Part	Materials	Finish
Shell	Brass	Gold plating
Male contact	Brass	Gold plating
Female contact	Beryllium copper	Gold plating
Insulation	Tetrafluoride resin	

### Main performance characteristics

Items	Standard value
Contact resistance	5mΩ or less (at 1A DC)
Insulation resistance	1000 MΩ or more at 500 V DC
Withstand voltage	500V AC (rms) for 1 minute
Characteristic impedance	50Ω
Voltage standing wave ratio	1.2 or less at DC ~ 1000MHz


### **UM-P** plugs

	HRS No.	Part No.	Applicable cable	Α	φВ	Shape
¥	318-0190-0-40	UM-QP-1.5VCR3A(40)	1.5D-2V	18.8	1.8	Fig.4
*	318-0176-0-40	UM-QP-1.5WCR3A(40)	1.5D-2W	18.8	1.8	Fig.4
*	318-0164-0-40	UM-QP-2.5CR3A(40)	2.5D-2V	21	2.8	Fig.4

\*Center contact fix type




Fig.4



# L-shaped plug




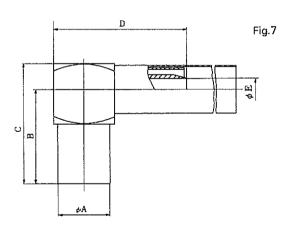

HRS No.	Part No.	Applicable cable	Α	В	С	D	φΕ	Shape
318-0162-5-40	UM-QLP-1.5-6(40)	1.5D-2V	6.3	10.4	13.3	14.1	1.8	Fig.7
318-0163-8-40	UM-QLP-1.5W-6(40)	1.5D-2W	6.3	10.4	13.3	14.1	1.8	Fig.7


### **UM-R** receptacles



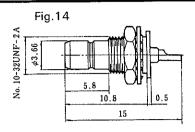


	HR\$ No.	Part No.	Remark
	CL318-0002-9-41	UM-QR(41)	Fig.14
- Annahaman	CL318-0011-0-41	UM-QR-1(41)	Fig.16




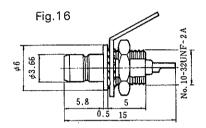


# UM-A linear adapters

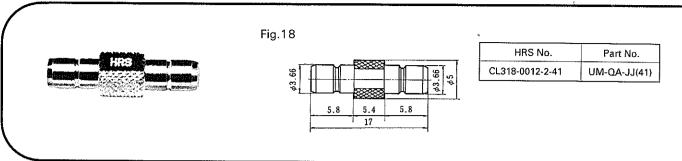


# Receptacles (type for mounting printed circuit boards)



L-type receptacle (type for mounting printed circuit boards)

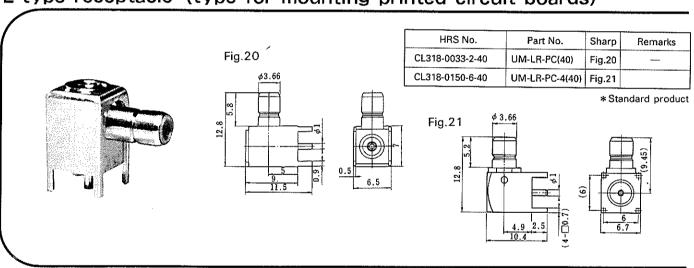

# Plug receptacle (type for mounting printed circuit boards)

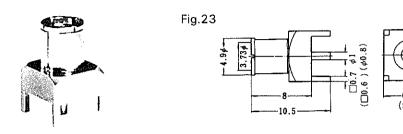

HRS No.	Part No.	Remarks
CL318-0036-0-40	UM-PR-PC(40)	6.7₽
CL318-0118-3-40	UM-PR-PC-1(40)	5.7


### **UM Series Plating Specifications List**


The UM series are available with the center contact gold-plated or silver-plated, and outer contact gold-plated or nickel-plated. Plating specifications by part numbers are as follows:


		Deat No.	UDO N	Cer	nter	Ou	ter
13	/pe	Part No.	HKS NO.	Gold	Silver	Gold	Nickel
		UM-QP-1.5VCR3A(40)	318-0190-0-40	0			0
PI	ug	UM-QP-1.5WCR3A(40)	318-0176-0-40	0			0
		UM-QP-2.5CR3A(40)	318-0164-0-40	0			0
	shaped UM-QLP-1.5-6(40) 318-0162-5-40	0		.,	0		
plug	]	UM-QLP-1.5W-6(40)	318-0163-8-40	0			0
		UM-QR(40)	318-0002-9-40	0		0	
Rece	ntacle	UM-QR(41)	318-0002-9-41	0			0
Nece	placie	UM-QR-1(40)	318-0011-0-40	190-0-40		0	
		UM-QR-1(41)	318-0011-0-41				0
Ade	pter	JM-QA-JJ(40) 318-0012-2-40	0		0		
Auc	iptei	UM-QA-JJ(41)	318-0012-2-41	0			0
		UM-R-PC(41)	318-0032-0-41	0		0	
	Rece pta-	UM-R-PC(40)	318-0032-0-40	0			0
	cle	UM-R-PC-1(41)	318-0054-2-41	0		0	
for		UM-R-PC-7(40)	318-0067-4-40	0			0
PC boad	L-	UM-LR-PC(41)	318-0033-2-41	0		0	
Doad	shaped rece	UM-LR-PC(40)	318-0033-2-40	0			0
	ptacle	UM-LR-PC-4(40)	318-0150-6-40	0			0
	Plug	UM-PR-PC(41)	318-0036-0-41	0		0	
	rece ptacle	UM-PR-PC(40)	318-0036-0-40	0			0
		UM-PR-PC-1(40)	318-0118-3-40	0		0	


### Connecting methods

### **Solderless** connecting system

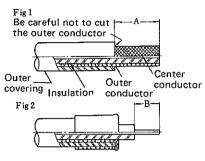








Part No.	Α	В
UM-QP -1.5	4.7	2,7
UM-QLP-1.5	4.7	1.1
UM-QJ -1.5	4.7	2.7
UM-QPJ-1.5	4.7	2.7


- Cut the outer covering as shown in the drawing on the left.
- 2. Insert the soft PVC and solderless sleeve, in that order, onto the cable. Fold back the outer conductor, and cut the insulator to obtain the dimensions indicated in B.
- 3. Insert the insulation into the center conductor of the cable. Next insert the center conductor into the center contact and solder it. (Be careful to avoid any solder build-up.)
- Insert this block into the plug. Insert the solderless sleeve, and crimp it with the proper tool. (As indi-cated) Cut off any of the outer conductor which is left outside the solderless sleeve at this time.
- Note: In the case of UM-QP-1.5, it is advisable to insert this block into the plug with the plug locator (UM-QP-T) fitted into position.


Dedicated fixture HT303/ UM-MSS-T-1


- Finally, insert the soft
- UM-QLP-1,5, In everything has been done up to Fig. 2, insert into the plug and then perform 4 and 5.
- Put the cable core into the split part of the center contact and solder it. (Be careful to avoid any solder build-up.)

### Clamping system

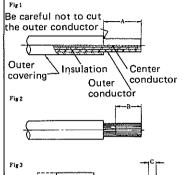





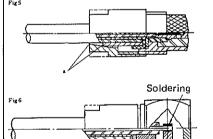


- С Part No. В UM-QP -196/U 4.0 2.7 1.0 UM-QLP-196/U 6.5 1.1 5.0 UM-QJ -196/U 4.0 1.0 2.7 UM-QPJ-196/U 4.0 2.7
  - 1. Cut the outer covering as shown in the drawing on the left.
  - 2. Disentangle the outer conductor, and cut the insulation as shown in the drawing on the left.
  - 3. Pass the cable through the cap, insert the clamp, and fold back the outer conductor as is shown in the drawing on the left. Cut the outer conductor at 1.4mm after inserting the washer. (The C dimensions are approximately the dimensions given in the table above.) Tighten the clamp in the direction of the split.)
  - Insert the insulation in front of the washer, insert the center contact into the core of the cable, and solder it. (Be careful to avoid any solder buildup).
- 5. Insert the insulation.
  - Insert this block into the plug and tighten the cap until they match at part "a."
  - Note: In the case of UM-QP-196/U, it is advisable to insert this block into the plug with the plug locator (UM-QP-T) fitted into position.
  - 7. In UM-QLP-196/U, after everything has been done up to Fig. 3, insert into the plug and then tighten the cap thoroughly.
  - Put the cable core into the split part of the center contact and solder it. (Be careful to avoid any build-up of solder.)

### Drawings of holes drilled for panel mounting


#### Mounting holes for UM-QR. UM-QPJ-1.5,

UM-SR, UM-SPJ-1.5,


UM-QPJ-196/U,



#### Mounting holes for UM-QR-1 UM-QR-8




#### For printed circuit boards




UM-R-PC, UM-PR-PC, UM-LR-PC, UM-LR-PC-4 Note: UM-R-PC-1, UM-PR-PC-1 are also available with the dimensions given in parenthesis

### 1. UM-QP-1.5CR3 (02), UM-QP-2.5CR3 (02)

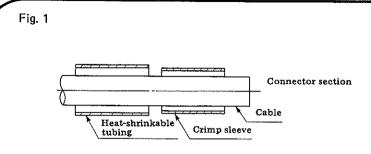

Mounting the heat-shrinkable tubing, crimp sleeve -----Fig. 1. Mount the heat-shrinkable tubing and crimp
sleeve in the cable as shown in Fig. 1.

Fig. 2

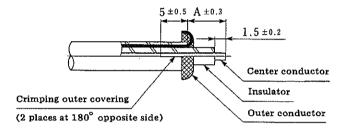


Cable end processing ------- Fig. 2.
 Process the cable ends as shown in Fig. 2.
 Dimension A shown under

Part No.	Α
UM-QP-1.5CR3(02)	6.8
UM-QP-2,5CR3(02)	5.6


Note: Be careful not to damage the outer conductor or center conductor of the cable.

Fig. 3

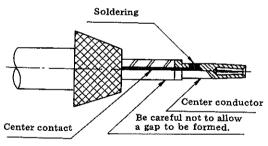

- 3. Solder the center contact ...... Fig. 3
  - (1) Solder the solder hole of center contact.
  - Insert cable center conductor into the solder hole and solder it.
  - Note 1: Be careful when soldering not to melt the cable insulator when soldering.
  - Note 2: Remove the extra solder by knife where the solder is applied.

Fig. 4

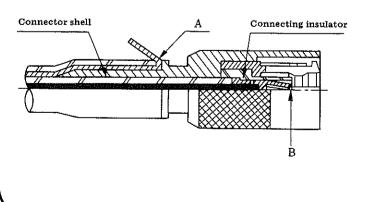

- 4. Insert the cable into the connector ...... Fig. 4.
  - (4) Insertion of cable is finished when the tip of center contact strikes against the connecting insulator at B section.
  - (2) Cut off the outer conductor by knife blade if it appears beyond A part.

#### List of Connection Tools

Working tools by applicable cable for the UM series are as listed in a table below.

Applicable cable	Part No.	Connecting tool name			
Applicable capte	rait NO.	For outer conductor	Lid press-fitting rod		
1.5D-2V	UM-QP-1.5VCR3A(40)	HT303/UM.MSS-T-1	_		
1.50-24	UM-QLP-1.5-6(40)	HT303/UM.MSS-T-1	UM-T-1		
1.5D-2W	UM-QP-1.5WCR3A(40)	HT303/PO-P-2-T	404		
1.3D-2 VV	UM-QLP-1.5W-6(40)	HT303/PO-P-2-T	UM-T-1		
2.5D-2V	UM-QP-2.5CR3A(40)	HT303/PO73-T-4	***		